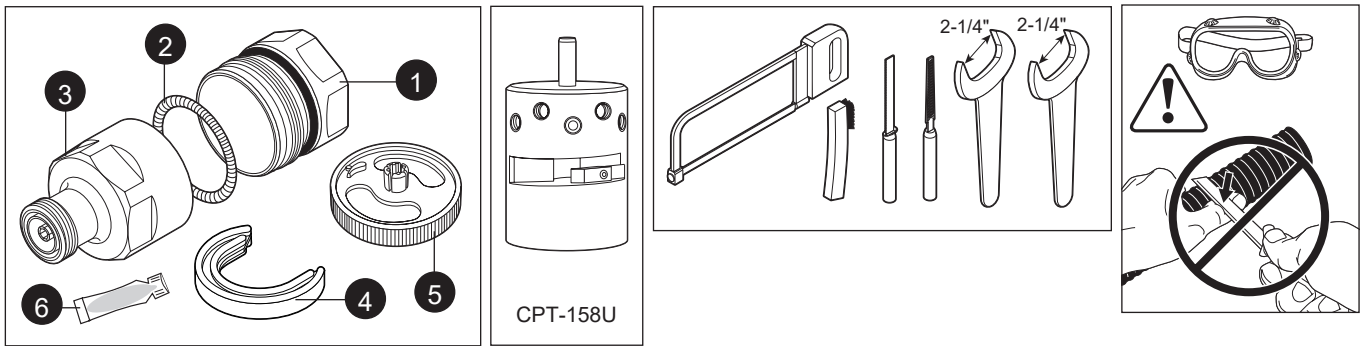
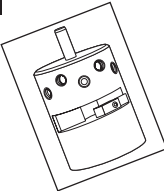
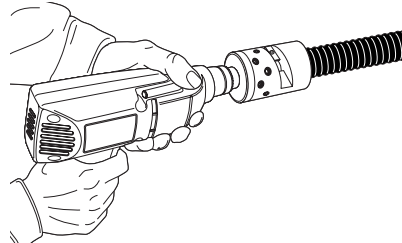
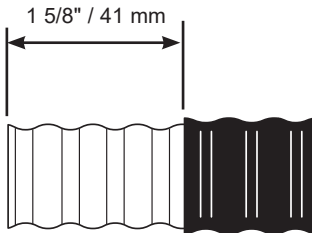
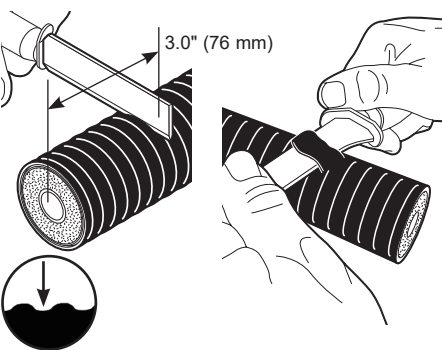
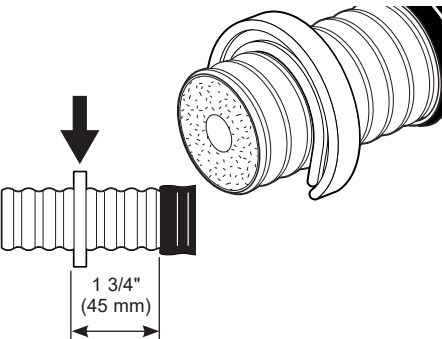
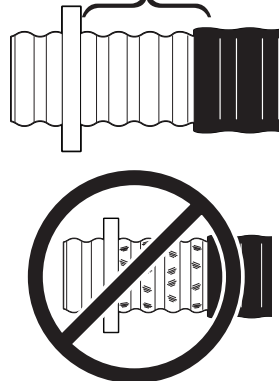
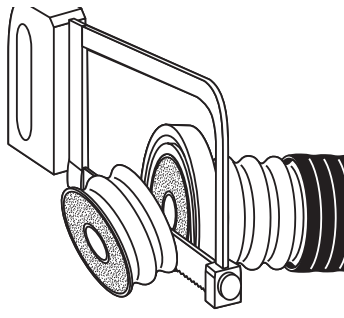
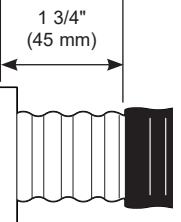



1 5/8" Positive Stop™ Connectors

For HELIAX® AVA7-50 and AVA7RK-50 Coaxial Cables

Bulletin 7546530 Revision F Page 1 of 2



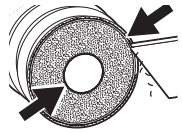
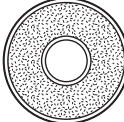
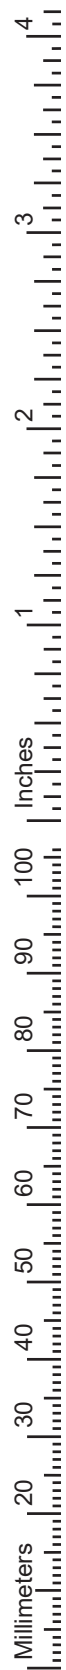
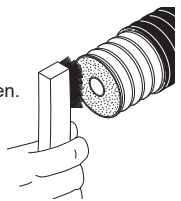
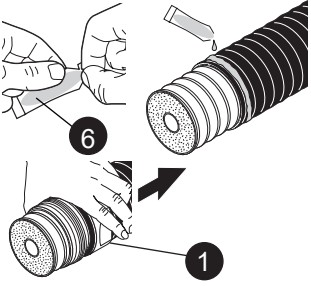
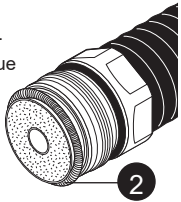
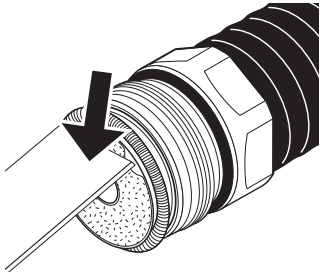
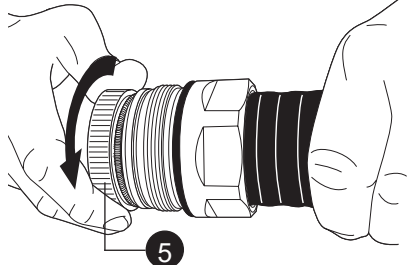
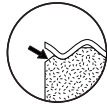
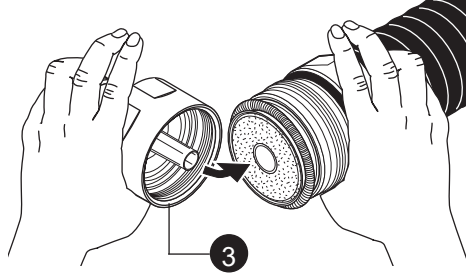
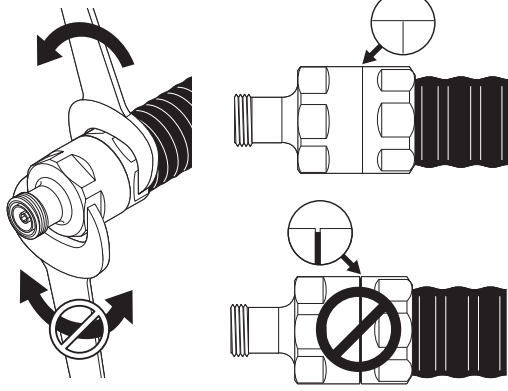
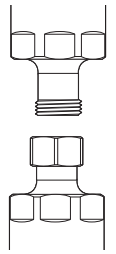
<p>1a</p>  <p>Trim cable jacket Recortar la envuelta del cable Coupez la gaine du câble Kabelmantel abziehen Retire a capa do cabo Rifilare la guaina del cavo. 切整電纜外皮</p>  <p>1 5/8" / 41 mm</p>  <p>7</p>	<p>1</p> <p>Trim cable jacket Recortar la envuelta del cable Coupez la gaine du câble Kabelmantel abziehen Retire a capa do cabo Rifilare la guaina del cavo. 切整電纜外皮</p>  <p>3.0" (76 mm)</p>	<p>2</p> <p>Position saw guide. Colocar en posición la guía de aserrar Positionnez le guide de la scie Sägeführung ausrichten Posicione a serra Posizionare la guida del seghetto 調整鋸導位置</p>  <p>1 3/4" (45 mm)</p>
<p>3</p> <p>Inspect sealing surface. If damaged, cut back and return to step 1. Inspeccione la superficie de asiento. Si está dañada, corte más atrás y vuelva al paso 1. Inspectez la surface d'étanchéité. Si elle est endommagée, raccourcissez à nouveau et recommencez à l'étape 1. Dichtfläche prüfen. Wenn beschädigt, zurückschneiden und zu Schritt 1 zurückgehen. Inspecione a superfície de vedação. Se estiver danificada, troque-a e retorne à etapa 1. Esaminare la superficie di tenuta. Se appare danneggiata, tagliare di nuovo e tornare al punto 1. 检查密封表面, 若有损坏, 请再削掉一段套管, 回到第 1 步。</p> <p>Sealing surface Superficie de asiento Surface d'étanchéité Dichtfläche Superfície de vedação 密封表面</p> 	<p>4</p> <p>Cut cable flush with saw guide. Corte el cable al nivel de la guía de la sierra. Coupez le câble en alignement avec le guide de scie. Kabel bündig mit Sägeführung abschneiden Corte as arestas do cabo com a guia da serra. Tagliare il cavo allineato con la guida del seghetto. 貼着鋸割導套將電纜鋸斷</p>  <p>1 3/4" (45 mm)</p> 	



1 5/8" Positive Stop™ Connectors

For HELIAX® AVA7-50 and AVA7RK-50 Coaxial Cables

Bulletin 7546530 Revision F Page 2 of 2

<p>5</p> <p>Deburr Quitar las virutas Ebavurez Entgraten Tirar as rebarbas Sbavare 去毛刺</p>  <p>Inside edge, inner conductor Borde interior, conductor interno Bord interne, conducteur intérieur Innenkante, Innenleiter Borda interna, condutor interno Bordo interno, conduttore interno 内缘, 内导体</p> <p>Outside edge, outer conductor Borde exterior, conductor externo Bord externe, conducteur extérieur Außenkante, Außenleiter Borda externa, condutor externo Bordo esterno, conduttore esterno 外缘, 外导体</p>	<p>Be sure outer conductor is round and undistorted Asegúrese de que el conductor externo es circular y no está deformado Vérifiez si le conducteur extérieur a conservé sa forme ronde, sans distorsion Außenleiter muss rund und nicht verformt sein Verifique se o condutor externo está redondo e se não está deformado Verificare che il conduttore esterno sia tondo e non deformato 外导体必须呈圆形, 且没有变形</p> 	
<p>6</p> <p>Remove debris. Retirar los restos. Enlevez les débris. Metallspäne entfernen. Remova os detritos. 去除残渣</p> 	<p>7</p> <p>Add clamping nut. Añadir la tuerca sujetadora. Mettez en place l'écrou de serrage. Klemmutter montieren. Acrescente a porca de aperto. 加緊固螺母</p> 	<p>8</p> <p>Add spring ring. Añadir el anillo elástico. Mettez en place la bague ressort. Federring montieren. Acrescente o anel de mola. 加彈簧圈</p> 
<p>9</p> <p>Compress foam. Comprimir el material de espuma. Comprimez la mousse. Verschäumung zusammendrücken. Comprima a espuma. 壓緊泡沫塑:</p> 	<p>5</p> 	<p>1/8" (3 mm) minimum Mínimo 1/8" (3 mm) 1/8" (3 mm) minimum Mind. 1/8" (3 mm) Mínimo de 1/8" (3 mm) Mínimo 1/8" (3 mm) 至少 英寸 1/8" (3 mm)</p> 
<p>10</p> 	<p>11</p> 	<p>Type N 15-20 lb-in (1.7-2.3 N·m) 7-16 DIN 220-265 lb-in (25-30 N·m)</p> 

NOTE: Connector interface threads and O-rings are designed for mate ability without ANY supplementary treatment to threads or O-rings. If any type of supplementary lubricants/oils are used, the warranty will be void, and connector/assembly performance may be affected.

ANDREW an Amphenol company
2601 Telecom Parkway, Richardson, Texas, 75082, USA
www.andrew.com

Technical Support
+1 888 297 6433, Option 3 (Toll Free US and Canada)
awpnarsupport@andrew.com

Notice: ANDREW disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.
Aviso: ANDREW no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.
Avis: ANDREW décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.
Hinweis: ANDREW lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.
Atenção: A ANDREW abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.
Avvertenza: ANDREW declina eventuali responsabilità derivanti dall'esecuzione di procedure di installazione, ispezione, manutenzione e smontaggio improprie o poco sicure.
注意: ANDREW 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的后果不負責任何義務和責任

©2025 ANDREW, an Amphenol company. All rights reserved. Amphenol and ANDREW are registered trademarks of Amphenol and/or its affiliates in the U.S. and other countries. All product names, trademarks and registered trademarks are property of their respective owners.